



## Change List for Win8 Driver 10.0.0.75

Draft 08/02/2012

**Atheros is continuing Hot Fixes. This will be a list of running changes as we continue to fix defects against Win8 10.0.0.75 base code.**

### **Software changes between build 10.0.0.45 and 10.0.0.49**

- 1) Improve BT audio quality during WLAN connection
- 2) Fix DPC latency issue
- 3) Fix headset music lag via BT when using WB222
- 4) Fix ping timeout using WEP in noisy environment problem
- 5) Fix BSOD (x64\_0x7E\_athrx cwm\_get\_width+e ) issue
- 6) Fix chanin 0 RSSI low issue
- 7) Add an additional OID to add Wifi display IE into management frame
- 8) Avoid regulatory violation
- 9) Update INF entries
- 10) (SW-WOW) Fix, wlan took long to reconnect.
- 11) (SW-WOW) Fix, Red-X issue.
- 12) (SW-WOW) Improve, Increase retry count to enhance performance at noisy environment.
- 13) (SW-WOW) Add, new wakeup reason for "Acer Magic".
- 14) (SW-WOW) Add, WEP support.
- 15) (SW-WOW) Add, Library install path support.

### **Software changes between build 10.0.0.49 and 10.0.0.52**

- 1) Fix BSOD 0x9F at S3/S4 stress test issue.
- 2) (SW-WOW\_10\_04) Fix Dll path didn't include file name customer.dll.
- 3) (SW-WOW\_10\_04) Fix Wifi Card disappear at S3/S4 test if BT firmware didn't load.
- 4) (SW-WOW\_10\_04) Connect to wrong AP when FastConnect/SW-WOW at the same time.
- 5) (SW-WOW\_10\_05) Fix return wrong wakeup reason code.

### **Software changes between build 10.0.0.52 and 10.0.0.54**

- 1) (SW-WOW\_10\_06) Fix Red-X, cause by mismatch of AWKAE/SLEEP because power\_save\_init function reset counter to 0
- 2) (SW-WOW\_10\_06) Fix regression issue cause FW report wrong error code.
- 3) (SW-WOW\_10\_06) Fix Red-x, cause by fail to wake up chip.

### **Software changes between build 10.0.0.54 and 10.0.0.55**

- 1) (SW-WOW\_10\_07) Fix Fast-connect doesn't work issue
- 2) (SW-WOW\_10\_07) Fix SoftAP doesn't work issue.



## Change List for Win8 Driver 10.0.0.75

Draft 08/02/2012

### Software changes between build 10.0.0.55 and 10.0.0.59

- 1) Fix connection failure using TKIP/AES in the noisy environment\
- 2) Fix incorrect WLAN channel information in coex engine during scanning
- 3) Fix BSOD (X640x9F\_3\_IMAGE\_athrx.sys )
- 4) Fix STA disassociation when multicast key rotation on aruba ap
- 5) Enhance WLAN UL coex performance when there are two or three HID
- 6) Improve WLAN coex performance when WLAN is at low RSSI with BT interference
- 7) (SW-WOW\_10\_08) Cisco AP sends DeAuth when WB222 is just enter SW-WOW mode.

### Software changes between build 10.0.0.59 and 10.0.0.67

- 1) Make Win8 and Win7 driver mutual exclusive
- 2) Sparate .sys .inf .cat base on different operation system
- 3) Improve power sonsumption high when associate idel
- 4) Fixed BSOD
- 5) Update INF for new device id

### Software changes between build 10.0.0.67 and 10.0.0.74

- 1) (WB335 only) Fix 0xD1 BSOD when BT connect to BT headset
- 2) Enable WLAN rx diversity (Win7)
- 3) Add concurrency mode support for BT coex
- 4) OCS throughput tuning
- 5) Fix some 802.11w IOP issue.
- 6) Update INF entry

### Software changes between build 10.0.0.74 and 10.0.0.75

- 1) Fix BSOD 0x7E when S3 stress test
- 2) Fix BSOD at reboot when using HB92/HB95/HB125/WB195/WB225